


SLIP INDICATOR LIGHT CIRCUIT

CIRCUIT DESCRIPTION

The SLIP indicator blinks during TRAC & VSC operation.

WIRING DIAGRAM

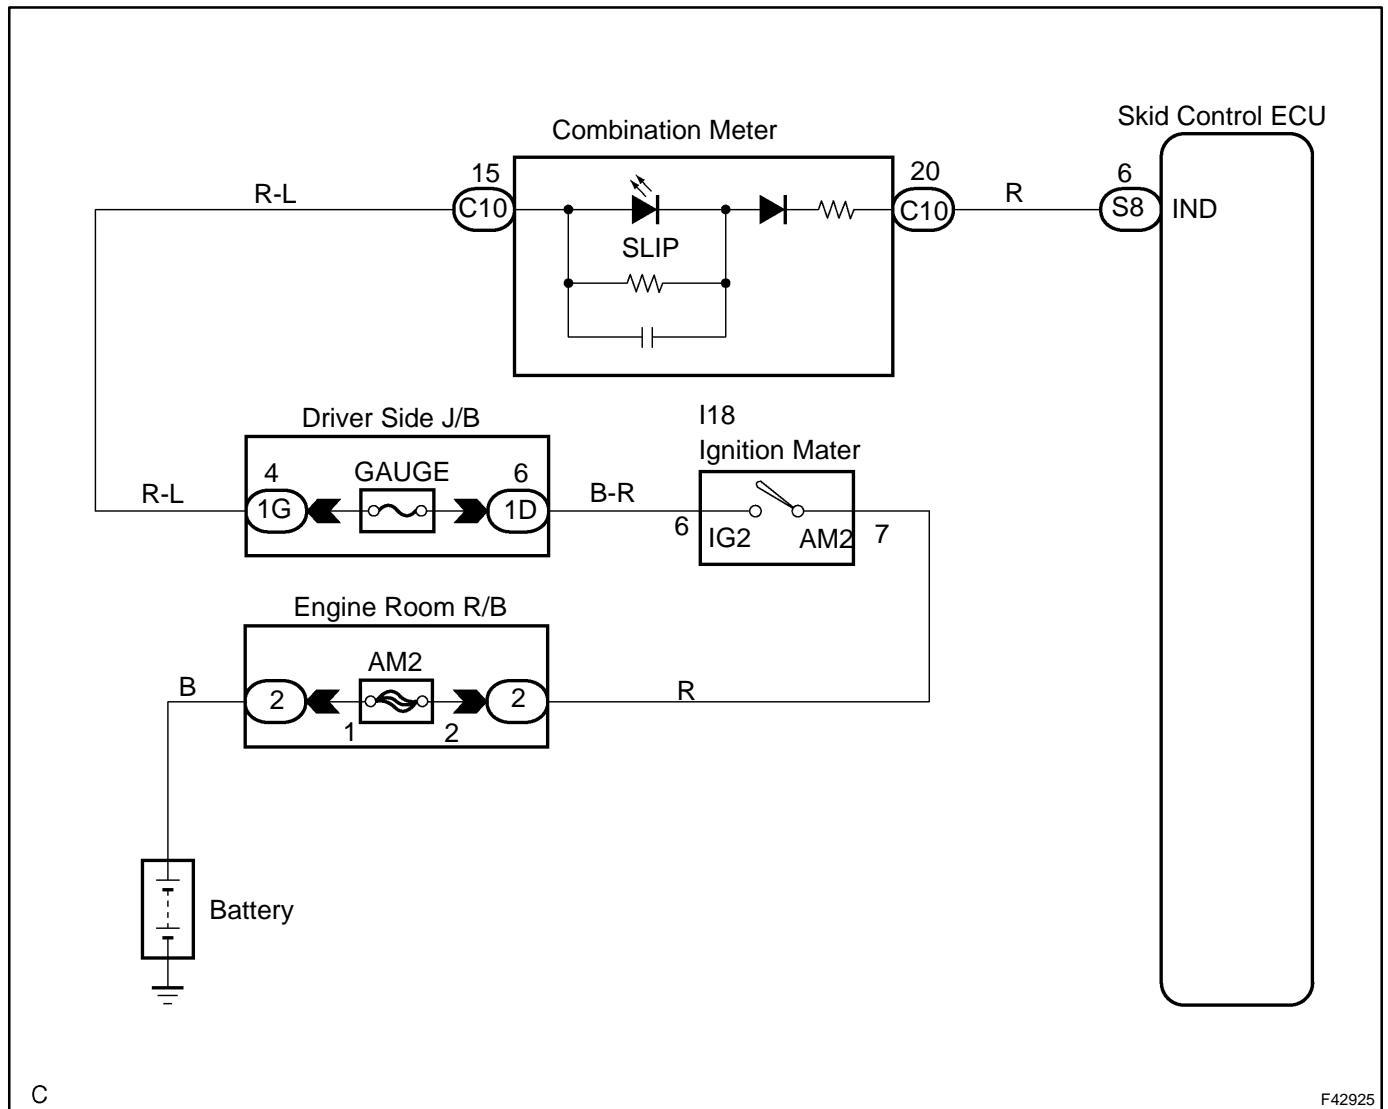

INSPECTION PROCEDURE

HINT:

Start the inspection from step 1 in case of using the hand-held tester and start from step 2 in case of not using the hand-held tester.

1 PERFORM ACTIVE TEST BY SLIP INDICATOR LIGHT

- (a) Check that "ON" and "OFF" of the SLIP indicator light can be shown on the combination meter with the hand-held tester.

OK

Go to step 3

NG

2 INSPECT SLIP INDICATOR LIGHT

- (a) See combination meter troubleshooting on page [05-1053](#) .

NG

REPAIR OR REPLACE COMBINATION METER ASSEMBLY

OK

3 CHECK HARNESS AND CONNECTOR(SKID CONTROL ECU - COMBINATION METER)

- (a) Check for open and short circuit in harness and connector between skid control ECU and combination meter (See page [01-35](#)).

NG

REPAIR OR REPLACE HARNESS OR CONNECTOR

OK

CHECK AND REPLACE SKID CONTROL ECU ASSY